B6 2nd Floor Struc. Plan
27/5/19

PRODUCED BY AN AUTODESK EDUCATIONAL PRODUCT

KAPL & SBC
Check Section 14 & Elevation. Portal side thk is 200 & top fascia beam is 400; KAPL to confirm. Also Beam TOP IS 450 sub

Check Section 14

Check cut out profile in Arch dwgs

HOLD

50
EXPANTION JOINT

Check Level of Beam

Check cutout profile

B149 Add to Schedule

BC11 Add to Schedule

B33 has to be inverted.

B35 to be 650mm depth.

Nomenclature missing for beam??

Beam Depths
650
500 with 150 drop
750
450
800

SCHEDULE OF BEAMS:-


R.C.C. 2ND FLOOR PLAN
TYPE B6

PRODUCED BY AN AUTODESK EDUCATIONAL PRODUCT

PRODUCED BY AN AUTODESK EDUCATIONAL PRODUCT


OK

B6
2nd floor
27/5/19

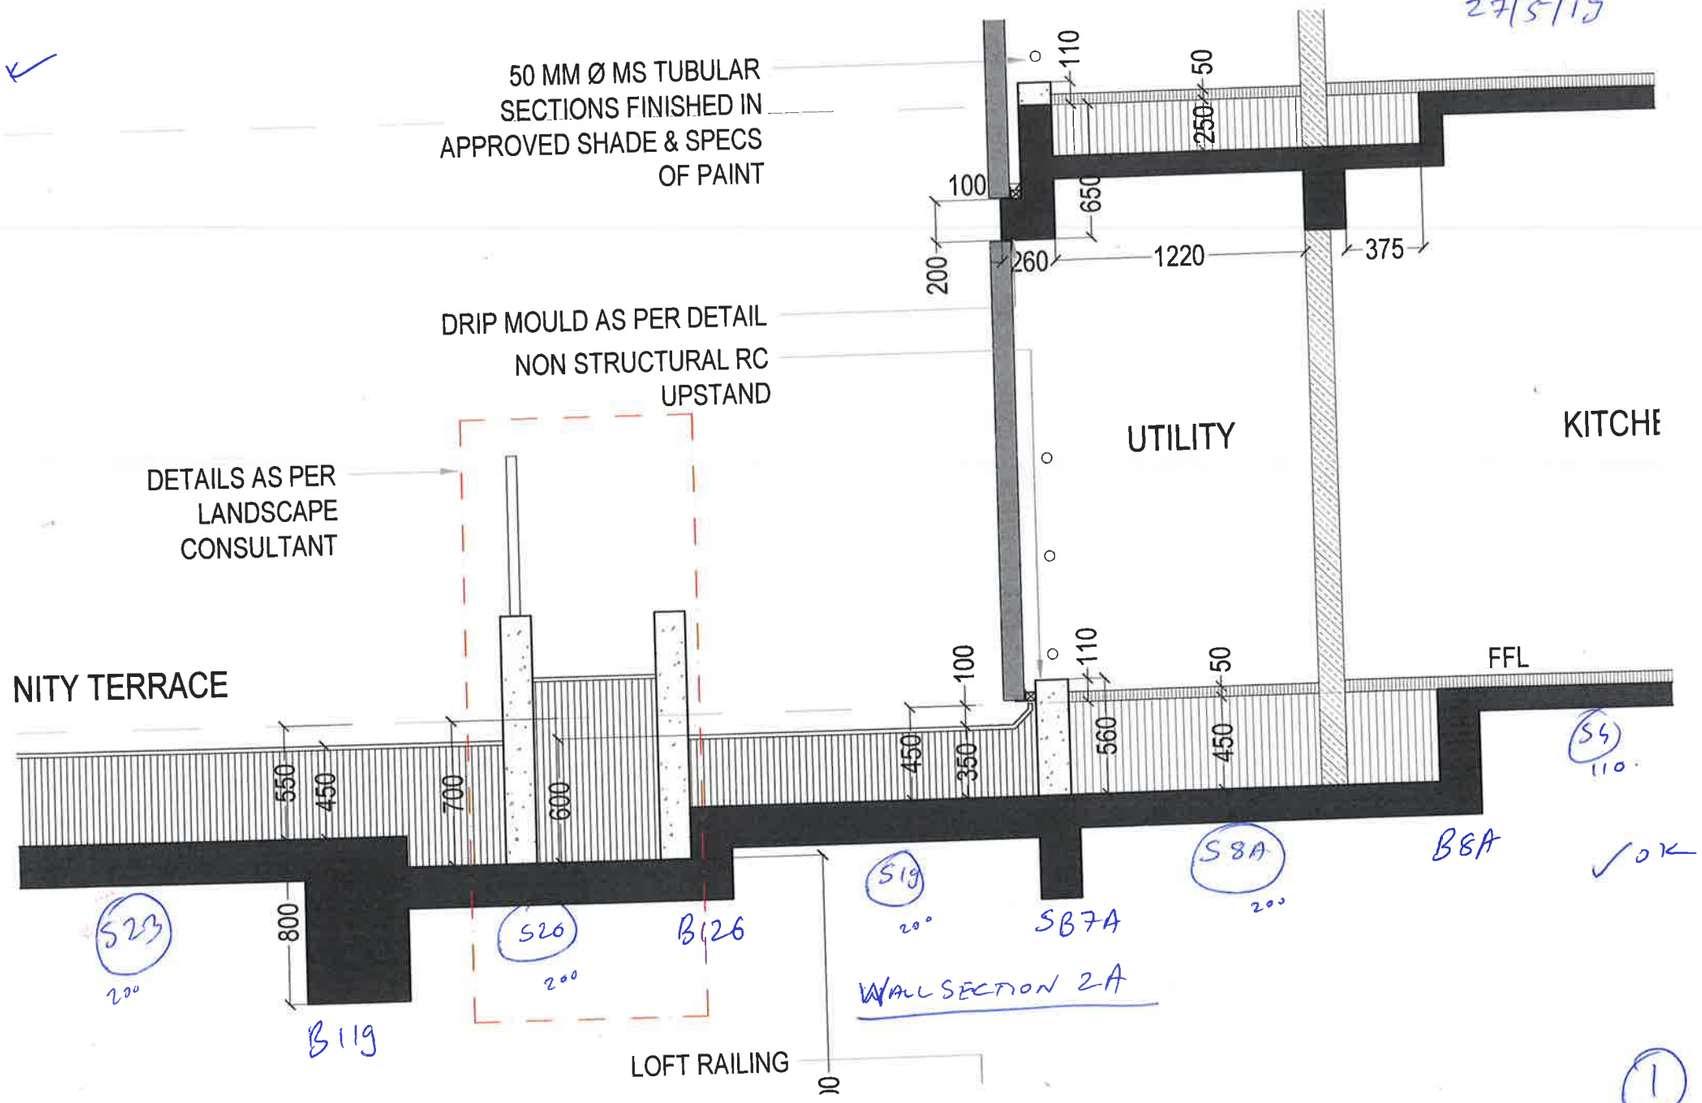


OK

B6
2nd f/1000
27/5/19

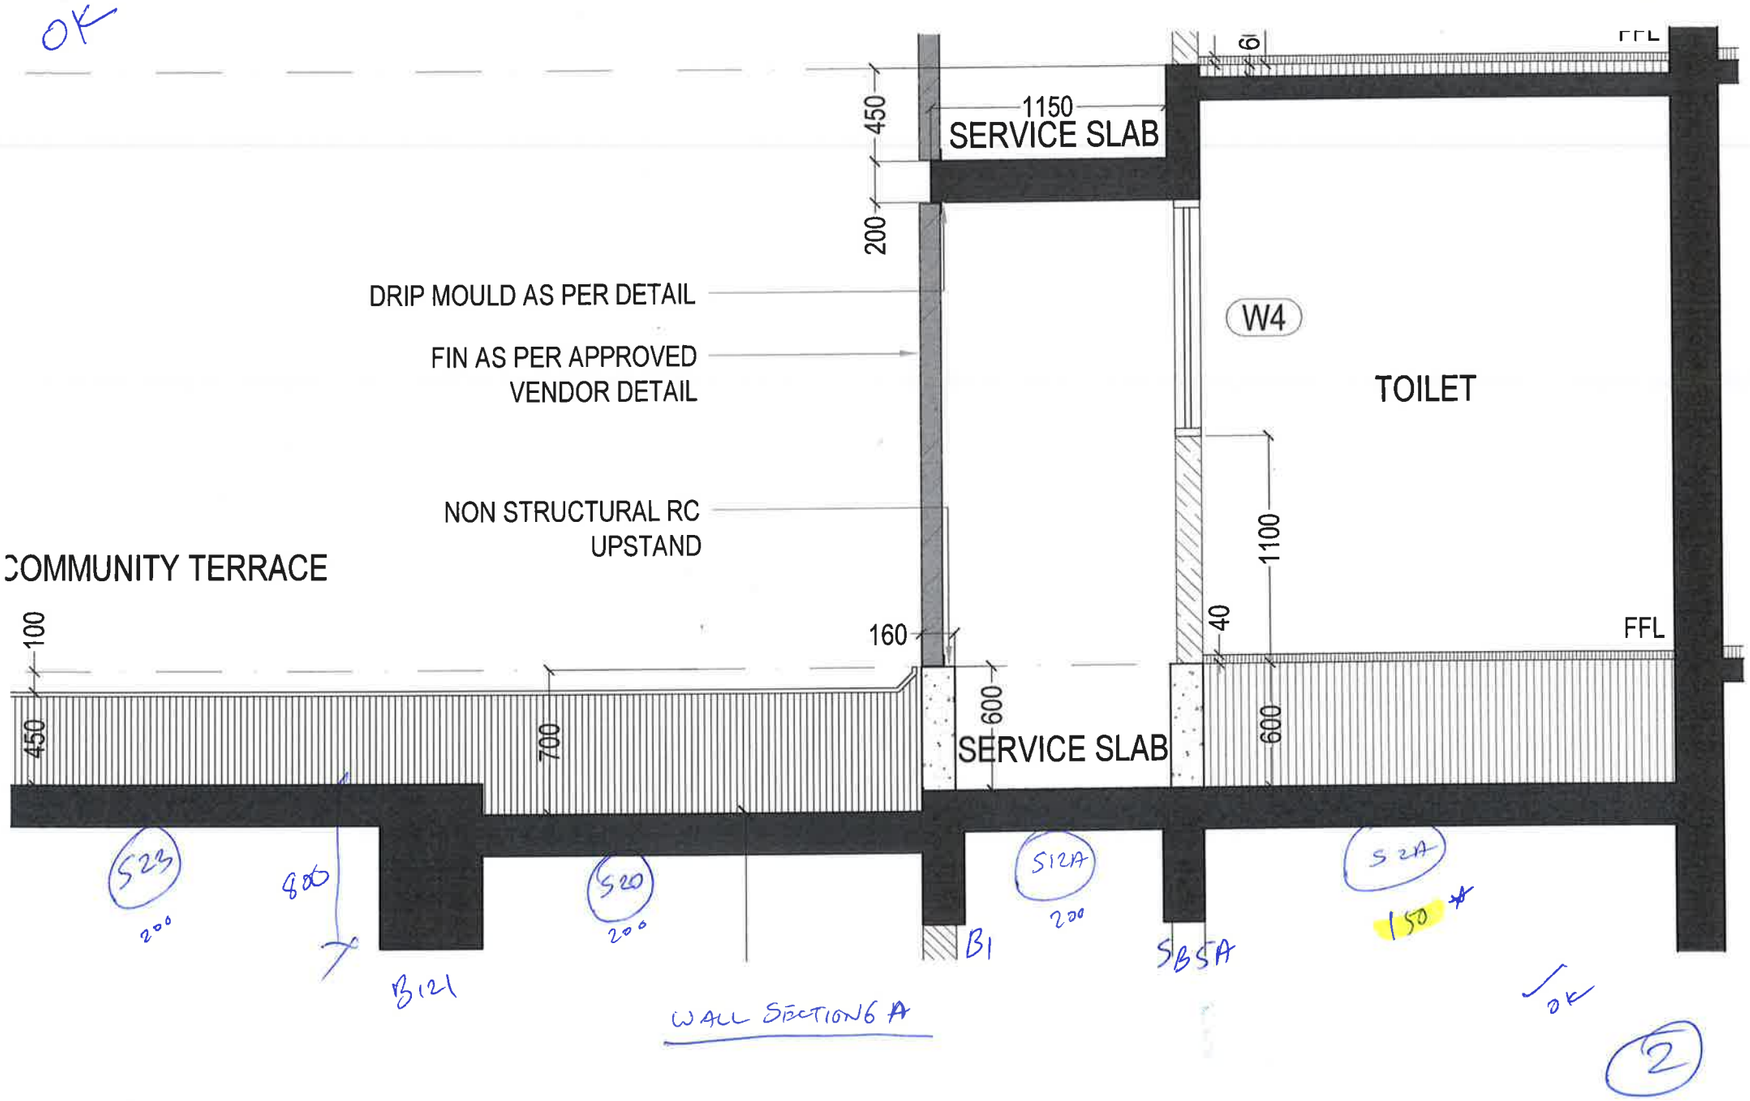

B6
2nd floor
27/5/19


OK

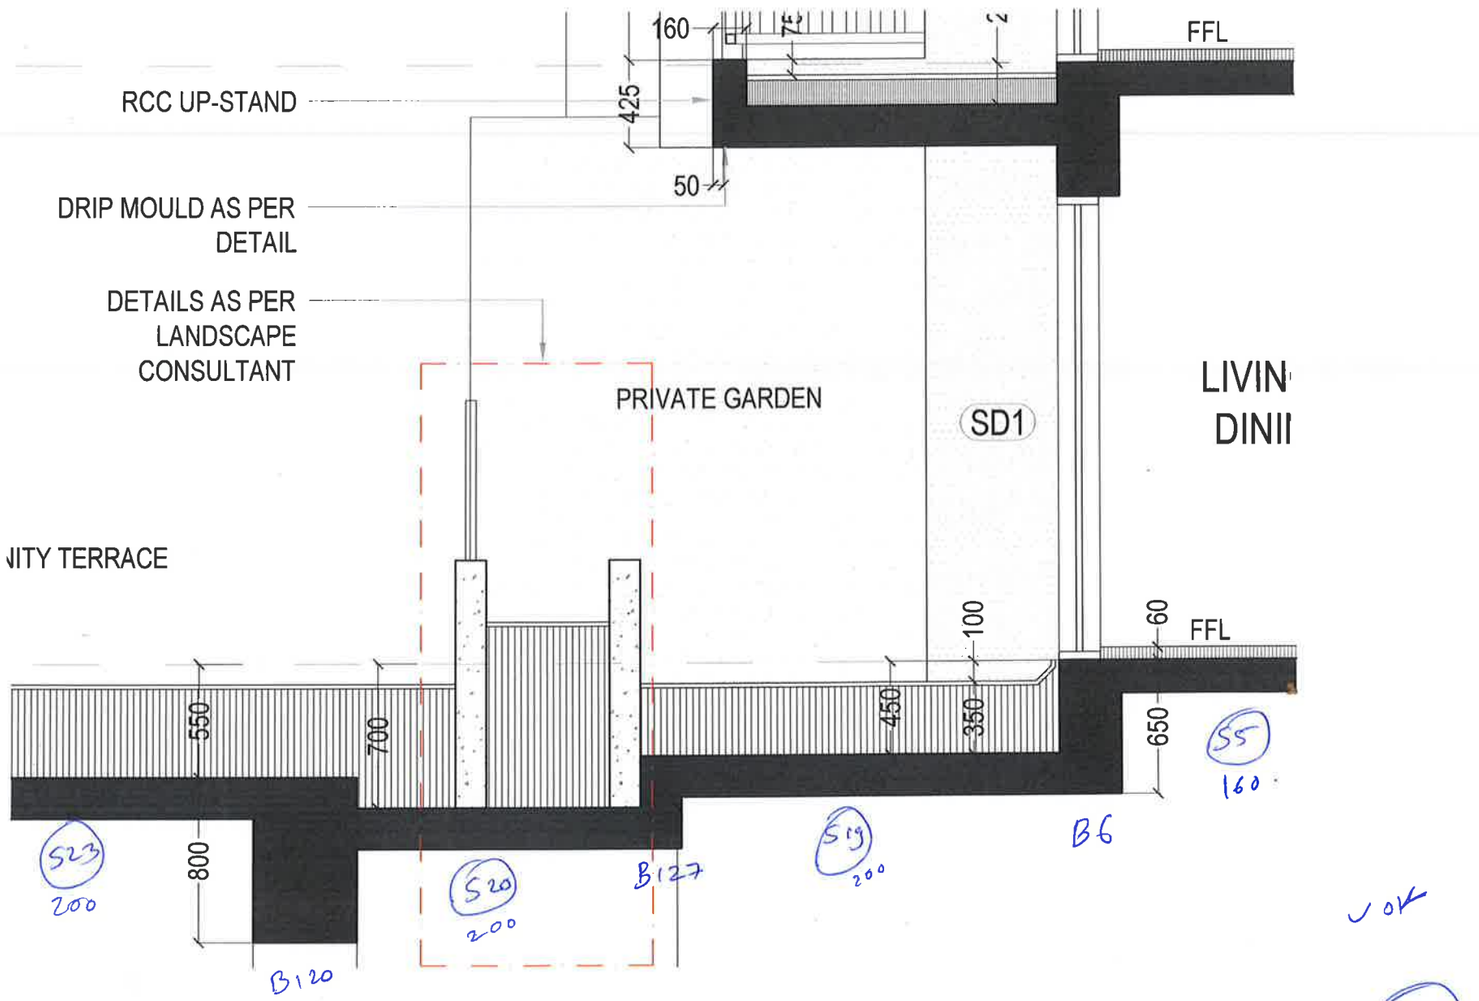

WALL SECTION #3A.

OK

2

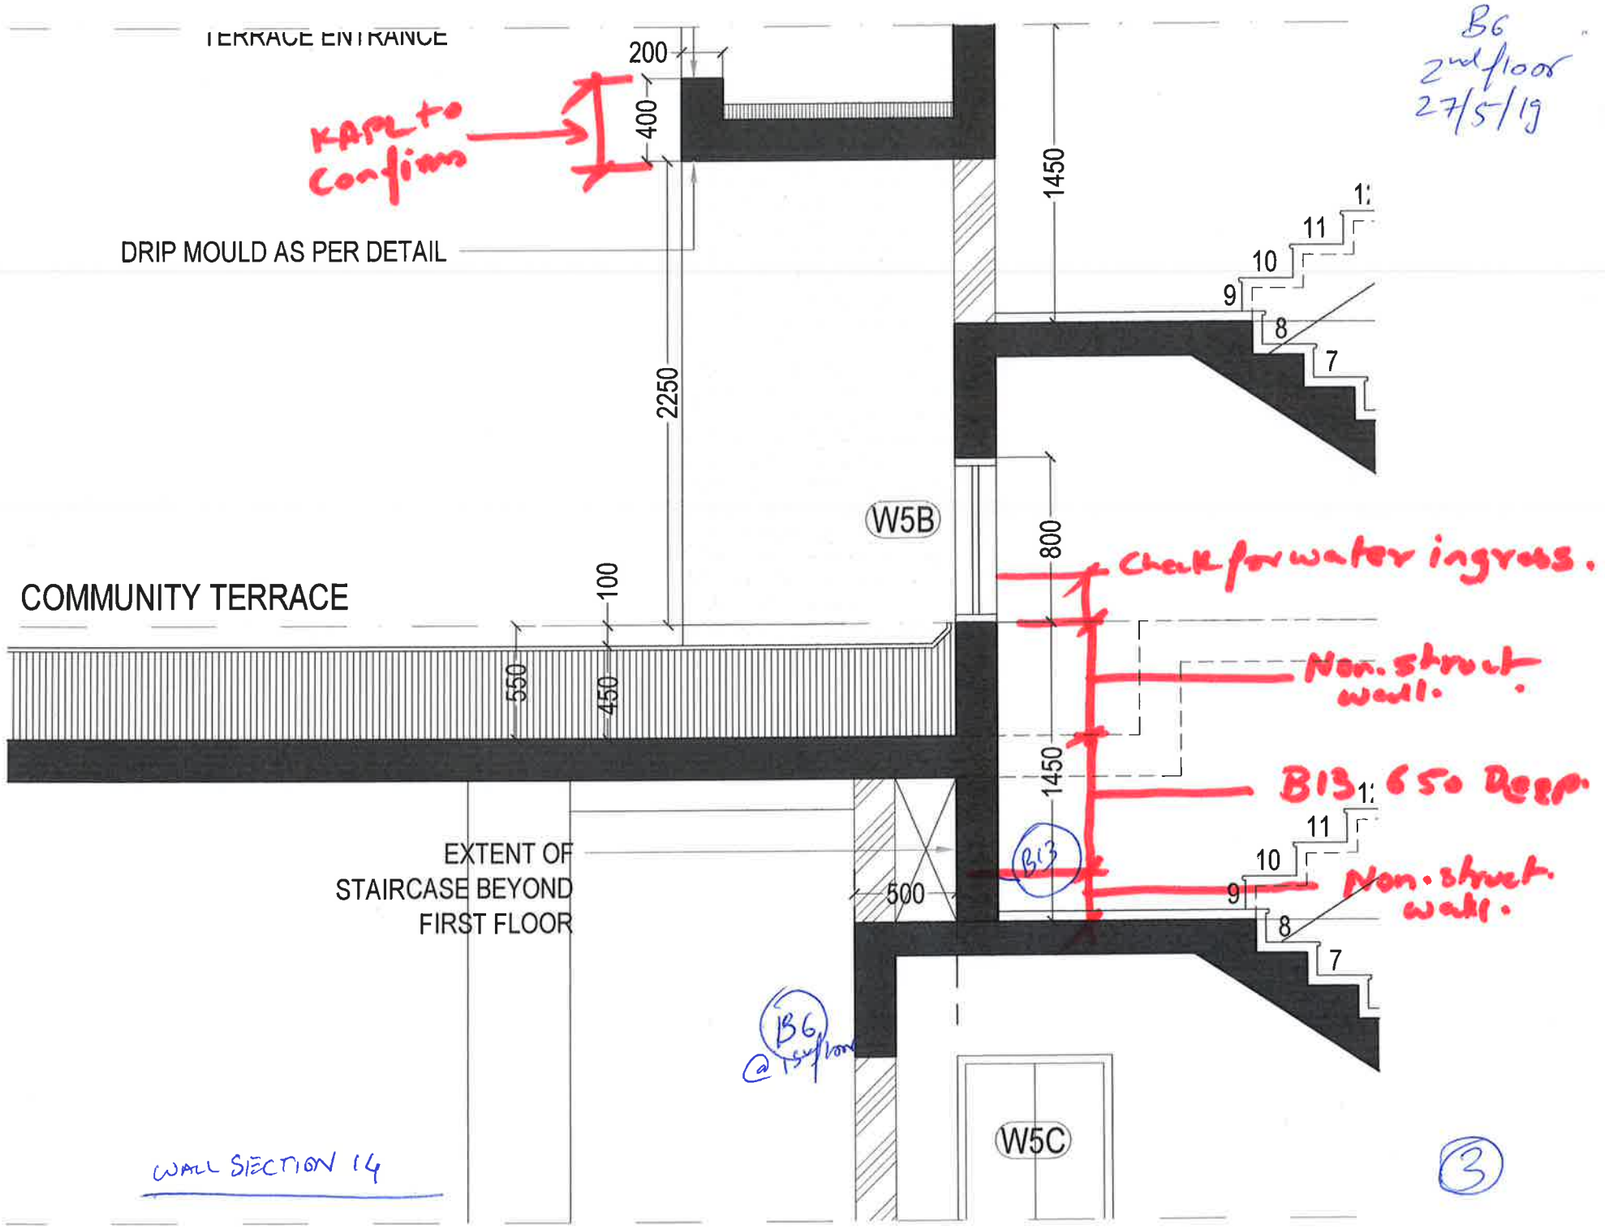
TERRACE ENTRANCE
200
400
KAPL to confirm
DRIP MOULD AS PER DETAIL
2250
100
COMMUNITY TERRACE
550
450
EXTENT OF
STAIRCASE BEYOND
FIRST FLOOR
500
W5B
W5C
1450
800
1450
B13
B6
@ 1st floor
11
10
9
8
7
check for water ingress.
Non. struct wall.
B13 650 Deep.
Non. struct wall.
KAPL To check
B6
2nd floor
27/5/19
WALL SECTION 14
3

KAPL & SBC to check

BG
2nd floor
27/5/19

200
200
400
2700
1200
1500
100
450
60
100
350
450

SBC To Check Beam Top Sunk in plan & change hatch accordingly.

COMMUNITY TE

STR-02
MID-LANDING LEVEL

KAPL LINE SEEN IN ELEVATION

← SW16


← ST1

COLUMN ST1 TO TERMINATE BELOW STRIP SUNK LEVEL AT COMMUNITY TERRACE.

4

WALL SECTION 13

B6
2nd floor
27/5/19.

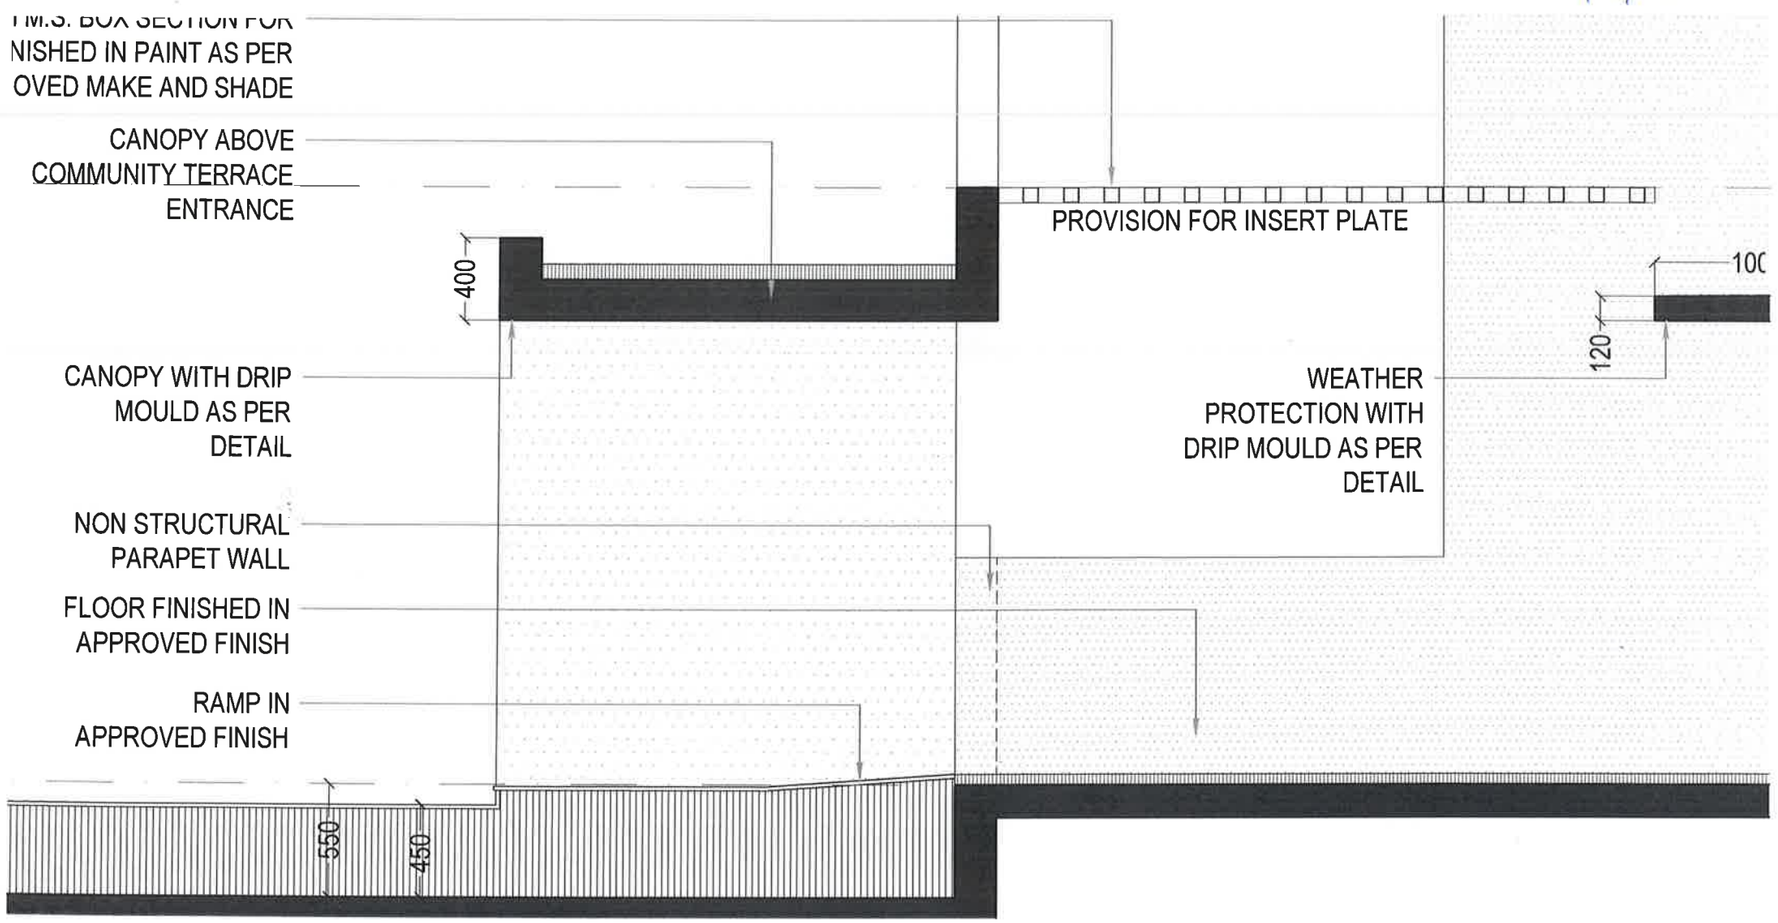

WALL SECTION 13A

(5)